

Bulky gloves

for Brother bulky gauge knitting machine with ribber

Basic worsted weight gloves in three sizes. Gloves are symmetrical, knitted from the bottom up with ribbing as the only seam.

SUPPLIES:

- Brother bulky gauge knitting machine and ribber
- '7' shaped weight hangers x2
- ribber cast-on comb, weights and holders

YARN:

- 55g (45g, 75g) Knit Picks Wool of the Andes "dragonfruit" ("ice lake heather", "rooibos heather") (MC)
- waste yarn (WY)

DIMENSIONS: when laying flat, not including thumb

S - 2.5in (6.25cm) wide by 9.5in (23.75cm)

M - 3in (7.5cm) wide by 10.5in (26.25cm)

L - 3.5in (8.75cm) wide by 11.5in (28.75cm)

To pick your size, measure the width of your palm flat, and go for some negative ease.

GAUGE: 20 stitches = 4in (10cm) by 26 rows = 4in (10cm)

ABBREVIATIONS:

CO - cast-on

COL/COR - carriage on left/right

dec - decrease

DSBTCO - Diana Sullivan's broken toe cast on

inc - increase

K - knit or pass carriage

KH - mainbed, back bed, or knitter

KR - ribber, or front bed

RC - row count or row counter

sts, st - stitches, stitch

w/ - with, in the yarn feeder

xfer - transfer




PATTERN: make 2

Set RC to 000

Cuff:


- 1) With KR at 3 full pitch, and COL select 34 (28, 42) across both beds so as to knit 1x1 ribbing (17 (14, 21) on each bed with rightmost st on KR)
- 2) Set tension to **min/min slider II**
- 3) K 1, COR
- 4) Hang the comb so that KR sts are caught in the comb as shown in the picture on top.
- 5) Disengage KR carriage,
- 6) K 2 with KR carriage only, COR

This has dropped the KR sts, leaving the comb to hang on the KH sts, the CO will not be so stretched out this way. This is Diana Sullivan's Broken Toe Cast-On (DSBTCO).

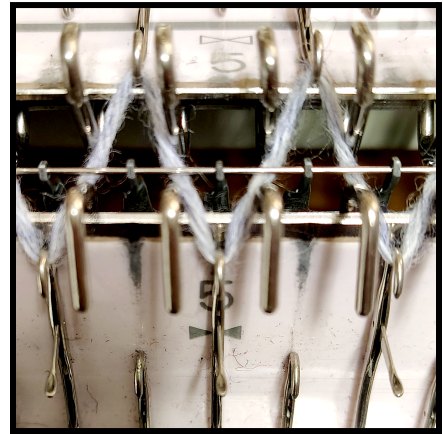

CO like this^^^

- 7) Reengage KR
- 8) K 1, COL
- 9) Set KH to slip left, and KR to slip right
- 10) K 3, COR
- 11) RC is 005 (this is DSBTCO)
- 12) Set tension to **0/0 slider II**
- 13) Set both carriages to knit in both directions, insert both '7's on each end with a small weight attached, make sure to raise every 10-15 rows
- 14) K 17 (15, 19) 1x1 rib, COL
- 15) RC is 022 (020, 024)
- 16) Xfer all sts to KH
- 17) Set tension to **2/2 slider I**
- 18) Change KR pitch to 2 half pitch
- 19) K 1, COR
- 20) RC is 023 (021, 025)

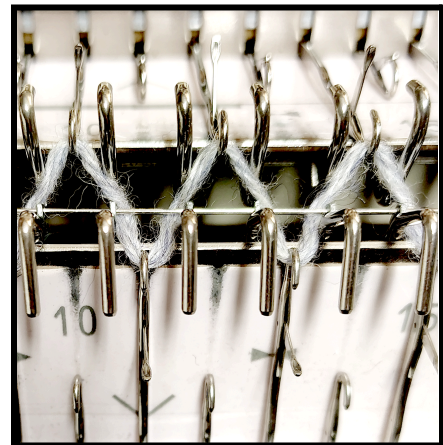

not like this^^^